ESTEL Service Bulletin

Model:

ΑII models with **AK37** Chassis.

Service

Bulletin No: 122

Priority

)S. All product.

-)A. Items in Customer / Dealer stock / Service return goods.
-)B. Customer stock / Units returned for Service.
- (X)C. Sold items returned for Service.
-)D. Only Units returned to this bulletin.
-)E. Others

SUBJECT: IC 800 defect **DATE:** August 07, 2002

<Objective>

Please modify if following symptom occurs

<Symptom>

TV does not work due to IC800 broke down

<Cause>

Spikes on main power affects and disturbs to IC 800.

<Countermeasures>

After changing the defected IC800,

In order to improve IC 800 resistant to spikes, modify the chassis as given below.

Replace,

R801 RES CF 1/4W 1K J ==> RES CF 1/4W 4.7K J

C860 CAP CER 100NF 100V ==> CAP MKT 47NF 250V J.

<Spare Parts order>

R801: VE-30000718 C860: VE-30000107

<Start Date of Modification on Production.>

26.05.2002